




USE RS422 CONTROL IN TO PROGRAM UNIT

In Programming Mode Prog link must be connected

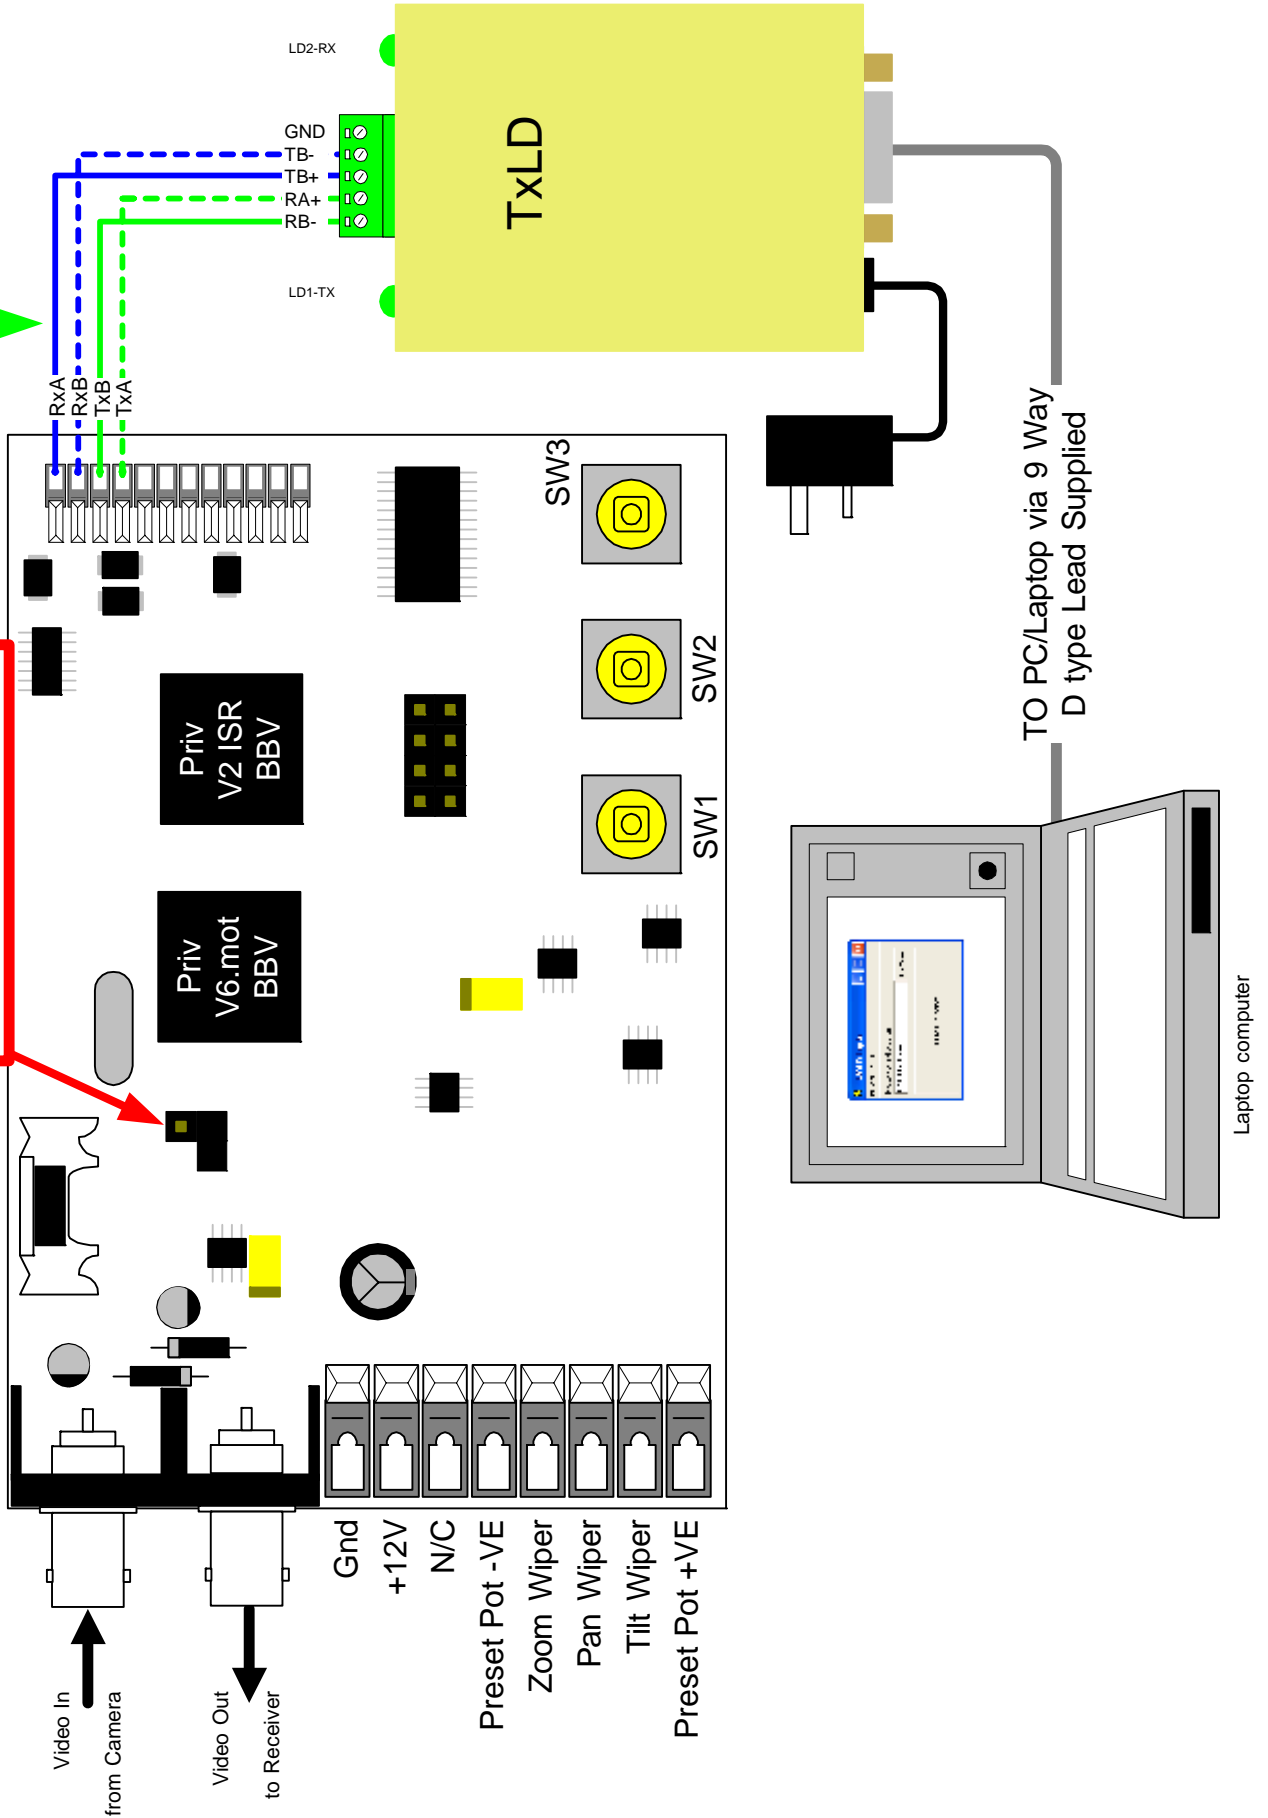

Building Block Video Ltd

(A PRIVACY BOARD BEING PROGRAMMED FROM A TxLD.23 11 2007)

17 Apex Park, Diplocks Industrial Estate, Hailsham, East Sussex, UK. BN27 3JU.


Tel:+44(0)1323 842727 Fax:+44 (0)1323 842728 Support:+44(0)1323 444600 www.bbvctv.com




These instructions for the programming utility Flash Simple, which must be unzipped into a directory named c:\FlashSimple. You will also need the software which is going to be used to update Privacy board "Priv_V**.mot" Please save this to your computer.

The procedure is as follows:

Run **FlashSimple.exe**

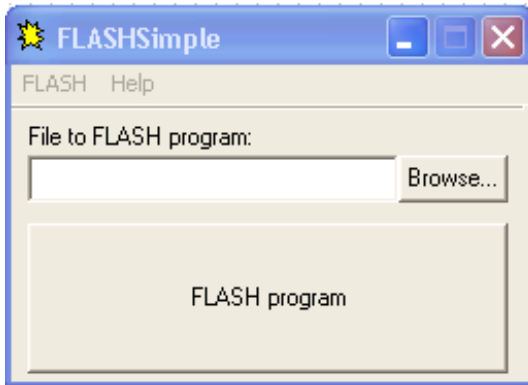

Select **FLASH** then **Settings**

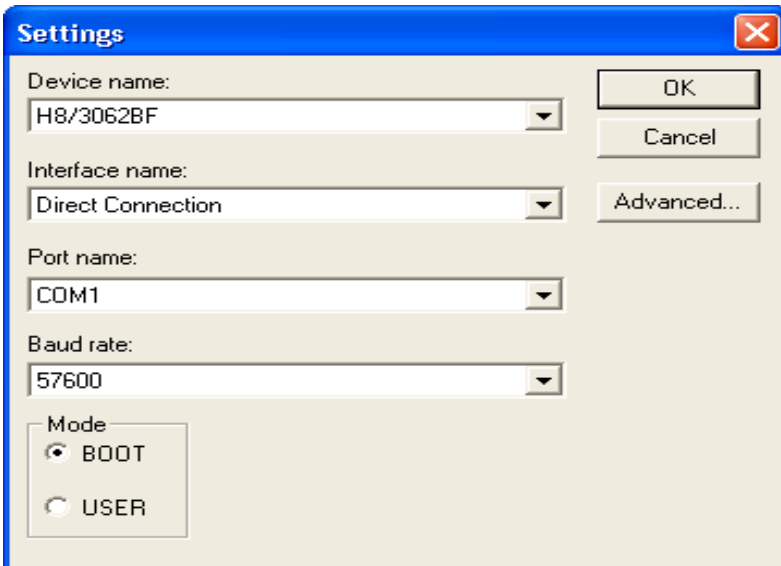

Set as shown:

Device name **H8/3062BF**

Interface name **Direct Connection**

Port name **COM1** or the number of the port that you are using

Baud rate **57600**

Mode **BOOT**


Then click **OK**

Building Block Video Ltd

(A PRIVACY BOARD BEING PROGRAMMED FROM A TxLD.23 11 2007)

17 Apex Park, Diplocks Industrial Estate, Hailsham, East Sussex, UK. BN27 3JU.


Tel:+44(0)1323 842727 Fax:+44 (0)1323 842728 Support:+44(0)1323 444600 www.bbvccctv.com

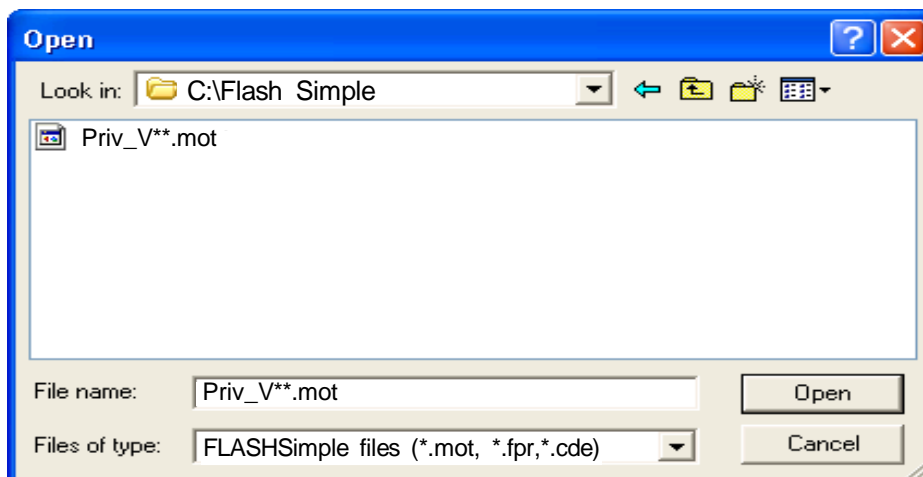

Power off the Receiver and fit the programming LINK on the Privacy board which is marked L1. Make sure the TxLD adapter is powered up.

Power up the Receiver

Click on **FLASH program** and the following status window will be displayed.

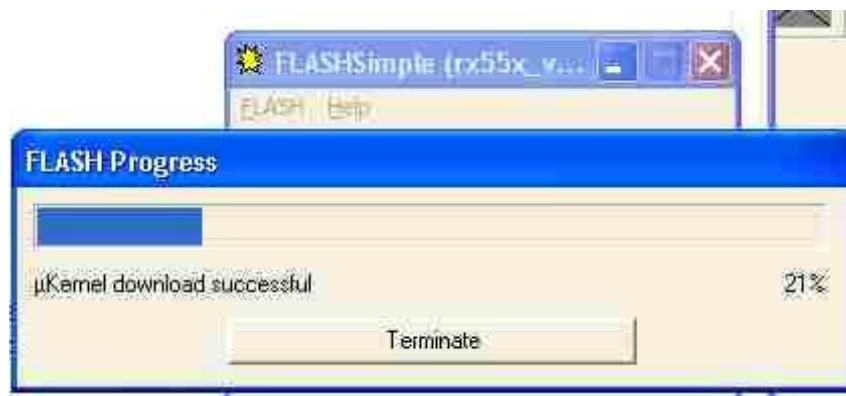

If programming is successful then this window is shown



Power off the Receiver and click **OK**. Then remove the programming link and power up Receiver. When the Privacy board is powered up it will show the software Version.

If you have another window that opens that shows an error then power the Receiver off and then on again and try programming again. If it still doesn't program correctly power the Receiver off again and make sure that the TxLD is connected correctly. Power the Receiver on again and try the procedure again.

It is VERY important to make sure that the programming Link is NOT removed when the Receiver is powered up as this could damage the micro processor.

Building Block Video Ltd

(A PRIVACY BOARD BEING PROGRAMMED FROM A TxLD.23 11 2007)

17 Apex Park, Diplocks Industrial Estate, Hailsham, East Sussex, UK. BN27 3JU.

Tel:+44(0)1323 842727 Fax:+44 (0)1323 842728 Support:+44(0)1323 444600 www.bbvctv.com